

KENWOOD

Service Bulletin

ASB-1028

Amateur Radio Division

Subject: TH-28/48/78 Difficult Battery Insertion
1993

Date: June 29,

Symptom:


Insertion of the battery into the transceiver is difficult or impossible due to problems with the release lever.

Corrective Action:

1. A temporary cure is provided by loosening the two screws securing the holder, shifting the holder to the extreme left, then retightening the screws.
2. A permanent fix is provided by replacing the holder and release lever with new parts that have been deburred and modified to allow relocation of the release lever.

Parts Required:

Qty	Description	Kenwood Part No.	Circuit Description
1	Holder	J19-1515-23	NA
1	Release Lever	D10-0610-13	NA

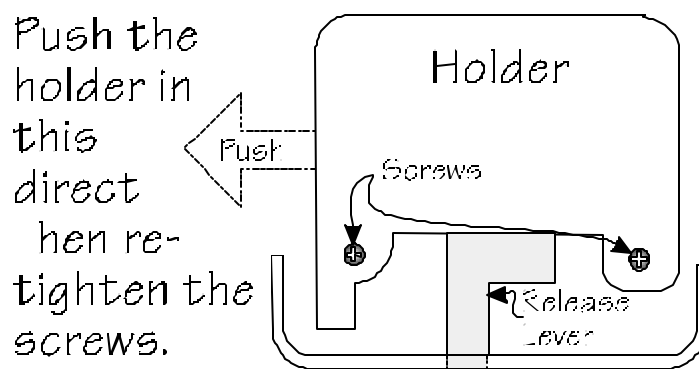

Time required for this modification is 30 minutes or less.

A:45 B:20 C:(TH-28/48) 36 D: 90
Service code A:45 B:20 C:(TH-78) 70 D: 90