

# KENWOOD

## Communications Division Service Bulletin

# ATB-0028

Date: February 12, 2004

### Title: TH-K2AT Reduced current drain when turned off

The microphone mute port of the MPU remains active when the transceiver is turned off, causing the battery pack to drain in a couple days. Production incorporated a new MPU at S/N 509xxxxx. Due to the difficulty in changing the MPU, the following hardware change was made available to correct the current drain condition.

Required Part #	Description
RK73HB1J104J	100K Resistor
R92-1368-05	0 Ohm Resistor
2SK1830	FET



